


Ord.code: FMS037-H01PO

Installation bracket of the Hub to the seat Politecnica Transeurope **Express**



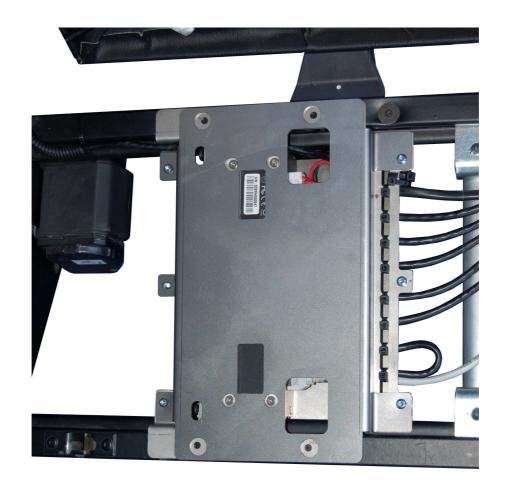


Date: 06/03/2014

Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T



Material needed for installation

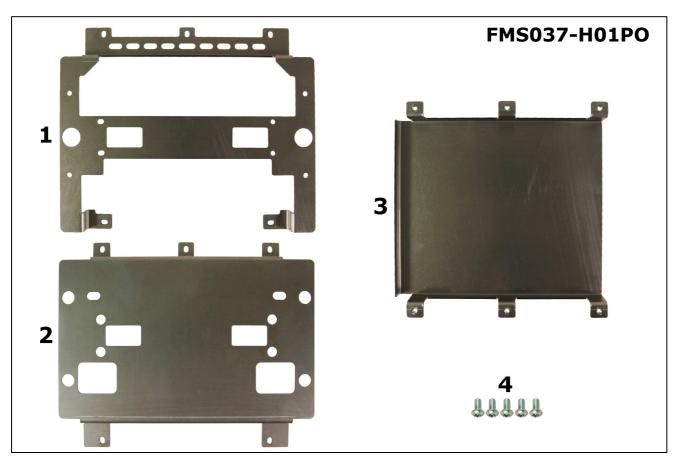

Pos.1	Name	Code	Pcs
1	Bracket of the Hub of the seat Politecnica Transeurope	0810346-M/1	1
2	Top cover of the Hub of the seat Politecnica Transeurope	0810402-M/1	1
3	Cover of the Hub of the seat Politecnica Transeurope Express	0810347-M/1	1
4	Screw M4x8mm with half-rounded head Torx	104BN6404M4x8	5

Chart N.1

+ required amount of tightening straps



Date: 06/03/2014 Page 2/7


Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T




WARNING!! Manual is a documented installation of the Hub under the left seat in left row of the bus seats. If you will be performing installation of the right seat in the right row of the seats please follow by mirror view - inverted.

1 - Before the installation of the Hub unscrew 4 screws, that are fixing the supports on Hub, remove the supports and with the original unmounted screws fix from bottom part of the bracket 0810346-M/1 (Chart N.1, pos.N.1) Hub (according figure N.1).

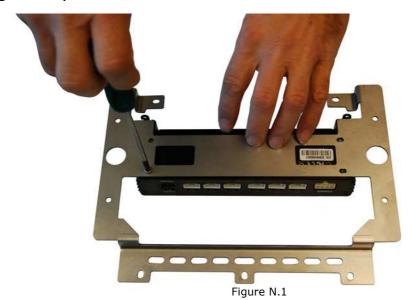

2 - Put mounted kit on the frame of the seat (according figure N.2)

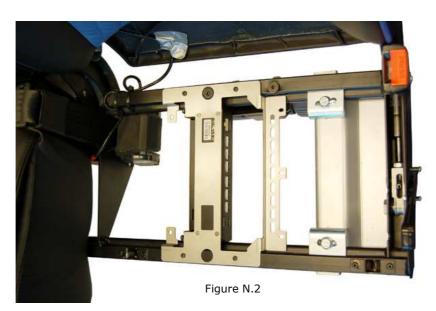

Date: 06/03/2014

Page 3/7

Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220,

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T

MOLPIR GROUP CZ a.s., Technologická 838/14, 779 00 Olomouc, Holice, Česká republika, Tel.: 00420 585 315 017, Fax: 00420 585 315 021, e-mail: molpir_o@molpir.cz, www.molpir.cz


MOLPIR GROUP CZ a.s., Business centrum Klamovka, Plzeňská 155/113, 150 00 Praha 5 – Košíře, Tel.: 00420 724 606 000, e-mail: jsvoboda@molpir.cz, www.molpir.cz

IČO: 25828843, DIČ: CZ25828843, ČSOB Olomouc, č. ú.: 377913723/0300, Registrace: KOS, OR Ostrava, oddíl B, vložka č. 2094


e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com



3 - Kit in frame of the seat move to such position, so the next hole for screw (marked with circle) will be from fixing point in frame of the seat far 10 mm in the direction to middle lengthways axis of the bus (according figure N.3).

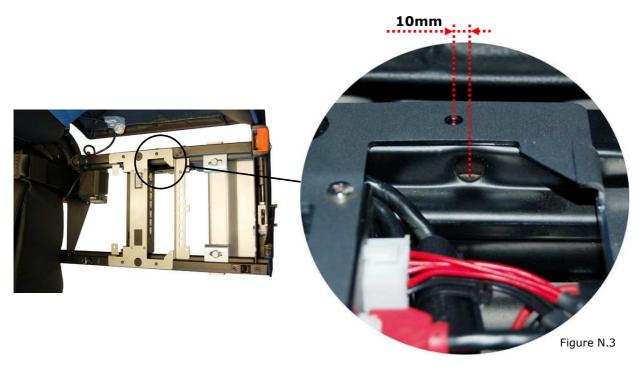

4 - Mark the 4 holes in the points of the arrows (according figure N.4)

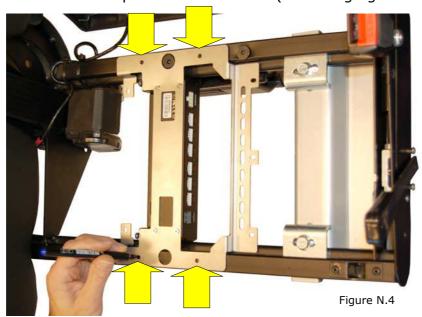



Date: 06/03/2014


Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T



Date: 06/03/2014

5 - Drill with the drilling machine(drill Ø3,5mm) into the main frame of the seat 4 holes and with them fix the kit with self-tapping screws 4,2mm (in marked points according the picture N.5).

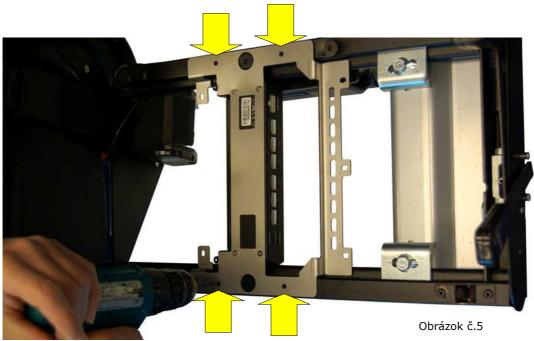

In this point we connect to Hub all needed cable inteconnections and properly attach them to bracket with tightening straps.

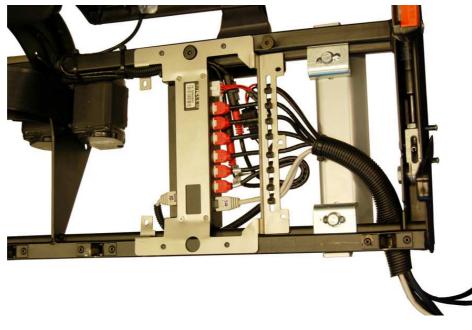



Figure N.6

Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T



- 6 Cover of the Hub-u 0810347-M/1 (chart N.1, pos.N.3) lay from the bottom side to already mounted kit on the seat.
- 7 Space between the bracket and the cover of the Hub use for placing of the cable connections and cabling.

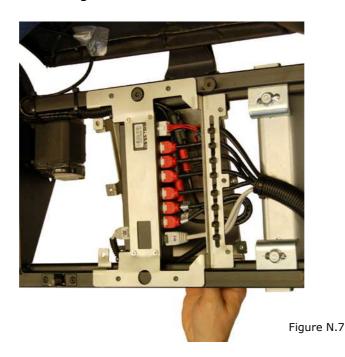

8 - Top cover of the Hub 0810402-M/1 (chart N.1, pos.N.2) lay from the upper side on the kit and fix with screws M4x8mm 104BN6404M4x8 (chart N.1, pos.N.4) to bottom cover 0810347-M/1 (chart N.1, pos.N.2) in places according the picture N.8

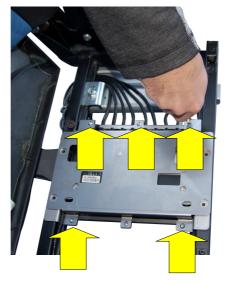


Figure N.8



Date: 06/03/2014

Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T



9 -The result of the assembly is assembled kit.

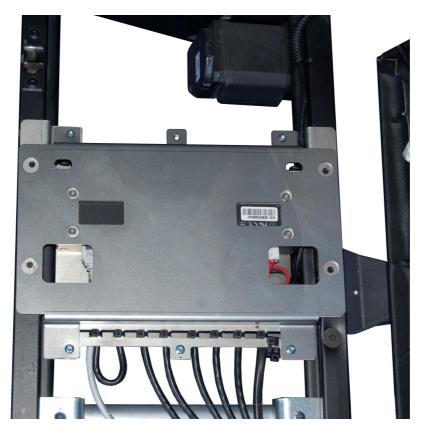


Figure N.9



Date: 06/03/2014

Molpir s.r.o. sídlo: SNP 129, 919 04 Smolenice; prevádzka: Hrachová 30, 821 05 Bratislava, Slovenská republika, Tel.: 00421 2 4319 1219, Fax: 00421 2 4319 1220, e-mail: obchod@molpir.com, www.molpir.com, www.shop.molpir.com

IČO: 31431372, IČpD: SK 2020391560, Tatra banka Bratislava, č. ú.: 2628020575/1100, register: OS Trnava, odd: Sro, vlož.: 1045/T