


FUNTORO 006

Production of cabling FMS-CA25-00350



FMS-CA37-00300



FMS-CA03-00300



FMS-CA25-00350



Components:

- | | |
|-------------------|------|
| 1. FMS-CA03-00300 | 1 pc |
| 2. FMS-CA37-00300 | 1 pc |

Process of production:

1. On cabling FMS-CA03-00300 remove by tapping RS232 and one USB outlet.
2. Connect FMS-CA37-00300 according figure N.1 into 36 pin connector.

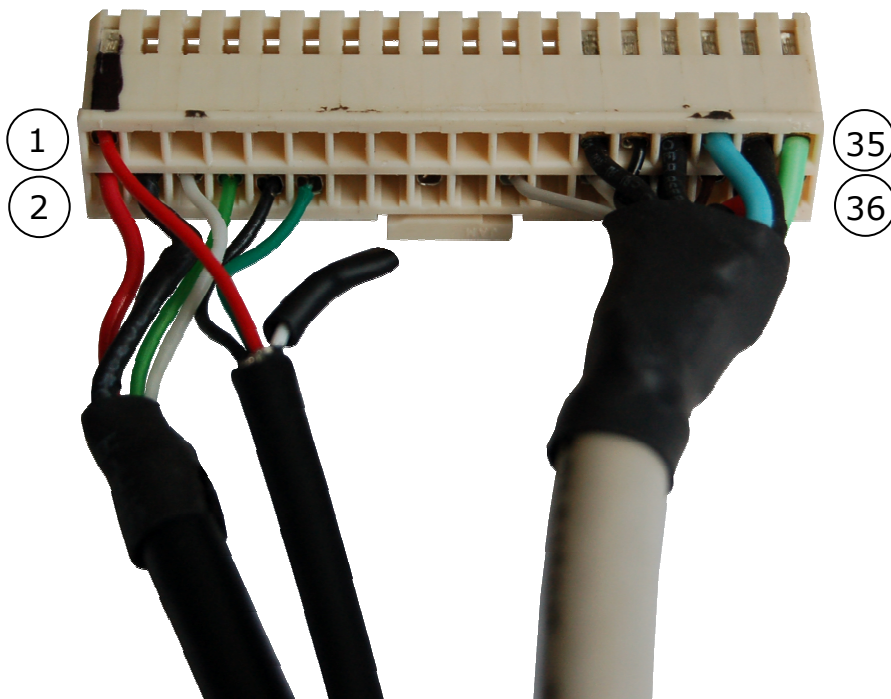


Figure N.1

Connection of contacts:

FMS-CA37-00300	JAM-36PIN
Red	1
Black	10
Green	12
White	Do not connect - insulate

Cabling connected like this is for one-way communication via RS232 with antenna GPS-E1 in operation of Funtoro MOD system.

